



To: John Egan, PE, GE  
Ron Hamburger, PE, SE  
Phil Lovett  
Kristin Gonsar  
Kelly McCormick  
Andrew Weichert

From: Debra Murphy, PE  
Nathaniel Wagner, PE, PhD

Date: August 25, 2021

Project Number: 19-009

Subject: 301 Mission Retrofit Monitoring Report 017: Results as of August 25, 2021

---

## CONTEXT

This memorandum summarizes results from the monitoring plan implemented at the 301 Mission property. Instrumentation to monitor the structure prior to, during and after the retrofit was installed in January 2021, including piezometers and extensometers. Settlement markers installed in April 2009 and January 2017, survey prisms mounted on the exterior of the structure in December 2016, and crack gauges installed in April 2009 have also been monitored.

## INTERPRETATION

Figure 01 presents the instrument locations as referenced in later figures.

Figure 02 presents the historical settlement data interpreted from settlement markers installed on the B-1 Level of 301 Mission Tower. In addition, data from surveys performed during the retrofit are included. Figure 03A presents differential settlement data since the start of production pile installation (May 12, 2021; baseline readings on May 10, 2021) through August 23, 2021. Figure 03B presents differential settlement data since January 11, 2021, through August 23, 2021. Figure 04 presents current differential settlement contours (in inches) on August 23, 2021.

Figure 05 presents historical lateral roof deflections in the project north-south and project east-west directions interpreted from survey prisms mounted on the exterior of the Tower, from InSAR data, and from a planar fit of the settlement marker data. In addition, data from survey performed during the retrofit are included. Figure 06A presents differential lateral roof deflection data from a planar fit of the settlement marker data and from survey prisms mounted on the exterior of the Tower since the start of production pile installation (May 12, 2021; baseline readings on May 10 and 13, 2021, respectively) through August 23, 2021. Figure 06B presents differential lateral roof deflection data from a planar fit of the settlement marker data and from survey prisms mounted on the exterior of the Tower since January 11, 2021, through August 23, 2021.

Figure 07 presents the historical groundwater elevation interpreted from piezometer readings at locations near 301 Mission. In addition, data from piezometers installed to monitor groundwater elevation during the retrofit are included. Figures 08 and 09 present groundwater elevation interpreted from piezometer readings in the Marine/Colma Sand and the Old Bay Clay, respectively, for the time period prior to the start of production pile installation (January 1, 2021) through August 25, 2021.

Figure 10 presents extensometer data from within the Tower basement since the start of production pile installation (May 12, 2021) through August 21, 2021. Figure 11 presents extensometer data from Fremont



Street since the start of production pile installation (May 12, 2021) through August 25, 2021. Figure 12 presents extensometer data from Mission Street since the start of production pile installation (May 12, 2021) through August 25, 2021.


## **CLOSING**

Please contact us if you have any comments or questions, or if you would like to discuss the results presented in this memorandum.

## **FIGURES**

- Figure 01A – Instrument Location Map: Settlement Markers, Piezometers, Extensometers
- Figure 01B – Tower Survey Prism Location Schematic
- Figure 02 – Historical Settlement Marker Data
- Figure 03A – Differential Settlement Marker Data since 05/10/2021 through 08/23/2021
- Figure 03B – Differential Settlement Marker Data since 01/11/2021 through 08/23/2021
- Figure 04 – Differential Settlement Contours since 05/10/2021 through 08/23/2021
- Figure 05 – Historical Lateral Roof Deflection Data
- Figure 06A – Differential Lateral Roof Deflection Data since 05/10/2021 through 08/23/2021
- Figure 06B – Differential Lateral Roof Deflection Data since 01/11/2021 through 08/23/2021
- Figure 07 – Historical Groundwater Elevation Measurements at Locations Near 301 Mission
- Figure 08 – Groundwater Elevation Measurements in Marine and Colma Sand since 01/01/2021 through 08/25/2021
- Figure 09 – Groundwater Elevation Measurements in Old Bay Clay since 01/01/2021 through 08/25/2021
- Figure 10 – Extensometer Data from within Tower Basement since 05/12/2021 through 08/21/2021
- Figure 11 – Extensometer Data from Fremont Street since 05/12/2021 through 08/25/2021
- Figure 12 – Extensometer Data from Mission Street since 05/12/2021 through 08/25/2021

Filepath: S:\StateDrive - Documents\Projects\_2019\19-009.00\_Millennium Tower Retrofit\10\_Construction\01\_Monitoring Reports\TowerSoilWater\00\_Figures\Fig\_017-01A\_Instrument\_Map.grf

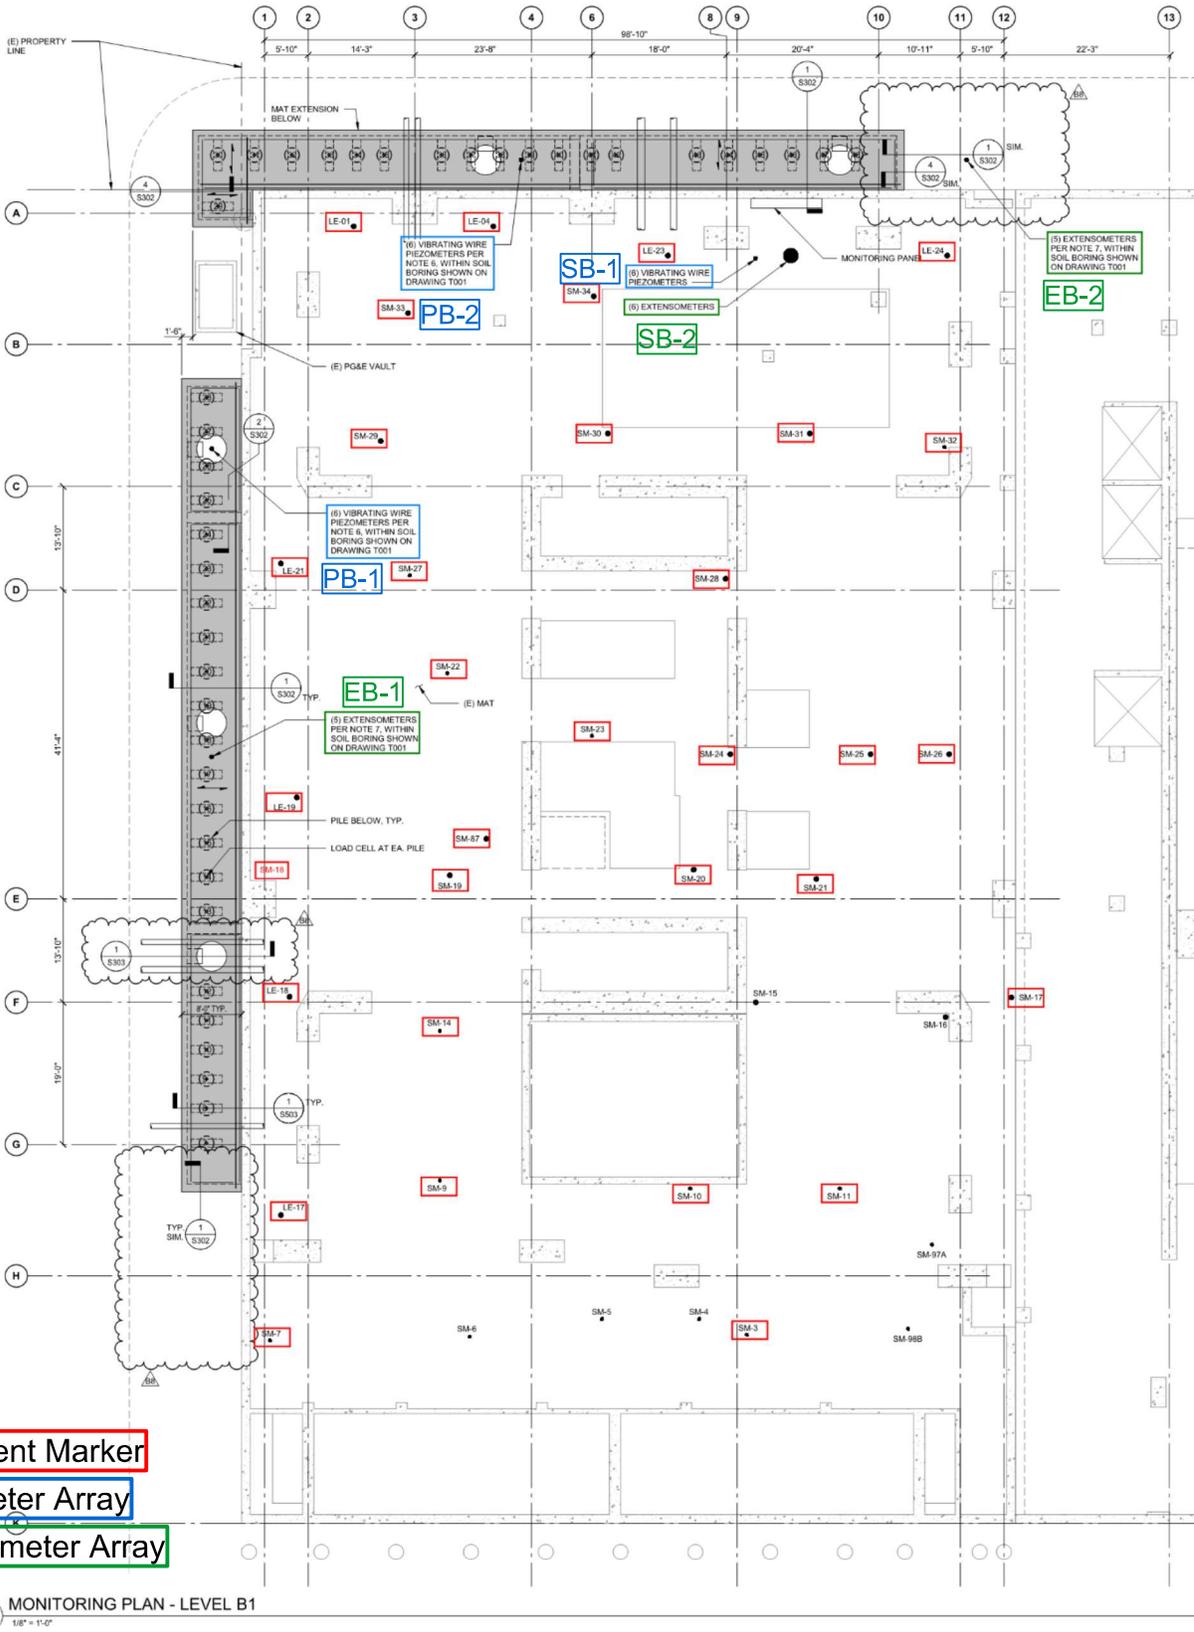

From 301 Mission Perimeter Pile Upgrade Bulletin 8 Set S 207 2021-06-15

Project No: 19-009.00

Date: 7/26/2021

Created By: NBW



Checked By: DGM

Figure No: **017-01A**



INSTRUMENT LOCATION MAP  
SETTLEMENT MARKERS, PIEZOMETERS, EXTENSOMETERS

Millennium Tower Perimeter Pile Upgrade: Instrumentation Monitoring Data  
City and County of San Francisco, California

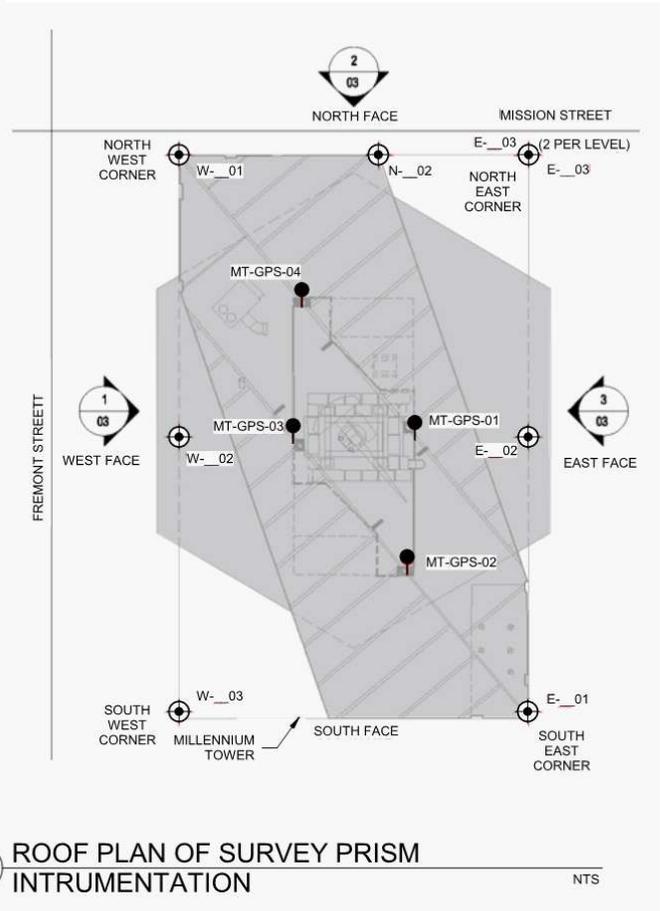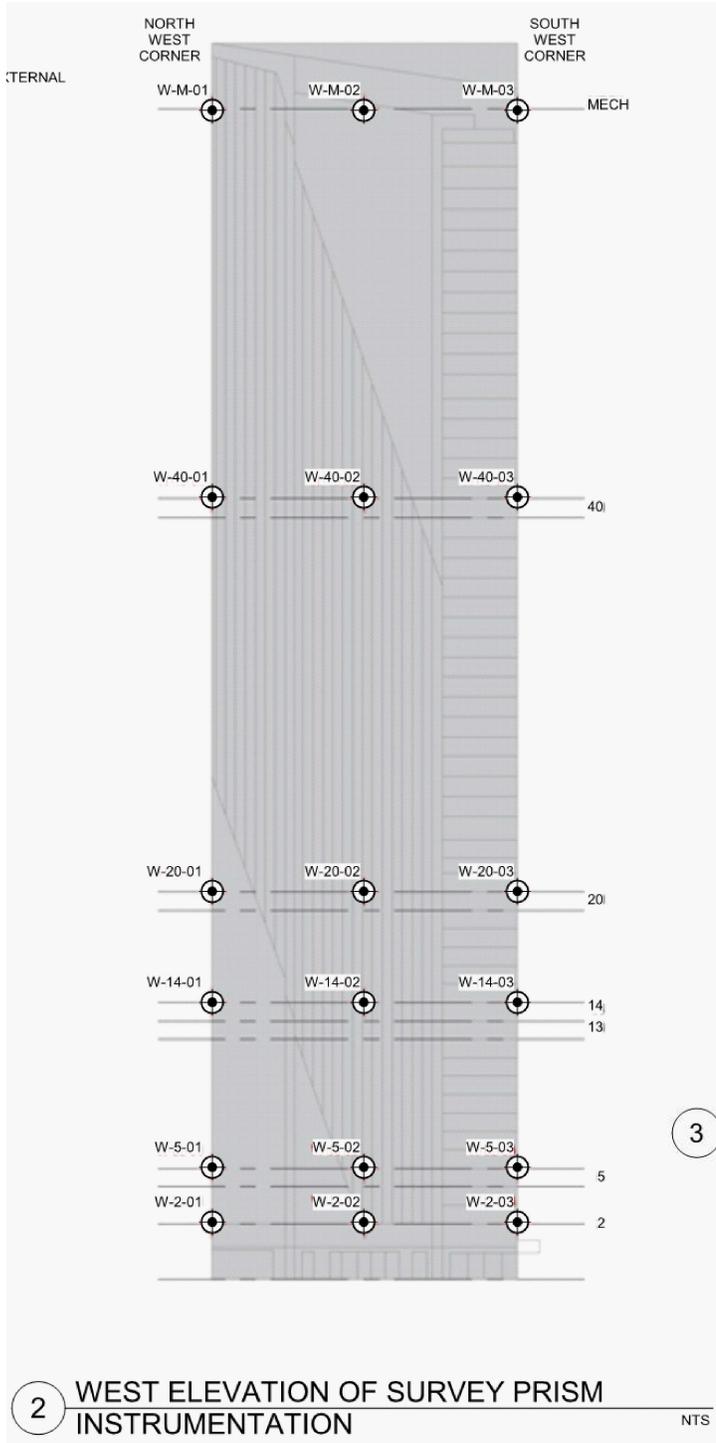


From 301 Mission Perimeter Pile Upgrade Bulletin 8 Set S 207 2021-06-15

Project No: 19-009.00	Date: 7/26/2021	Created By: NBW	Checked By: DGM	Figure No: <b>017-01B</b>
-----------------------	-----------------	-----------------	-----------------	---------------------------



TOWER SURVEY PRISM LOCATION SCHEMATIC

Millennium Tower Perimeter Pile Upgrade: Instrumentation Monitoring Data  
City and County of San Francisco, California

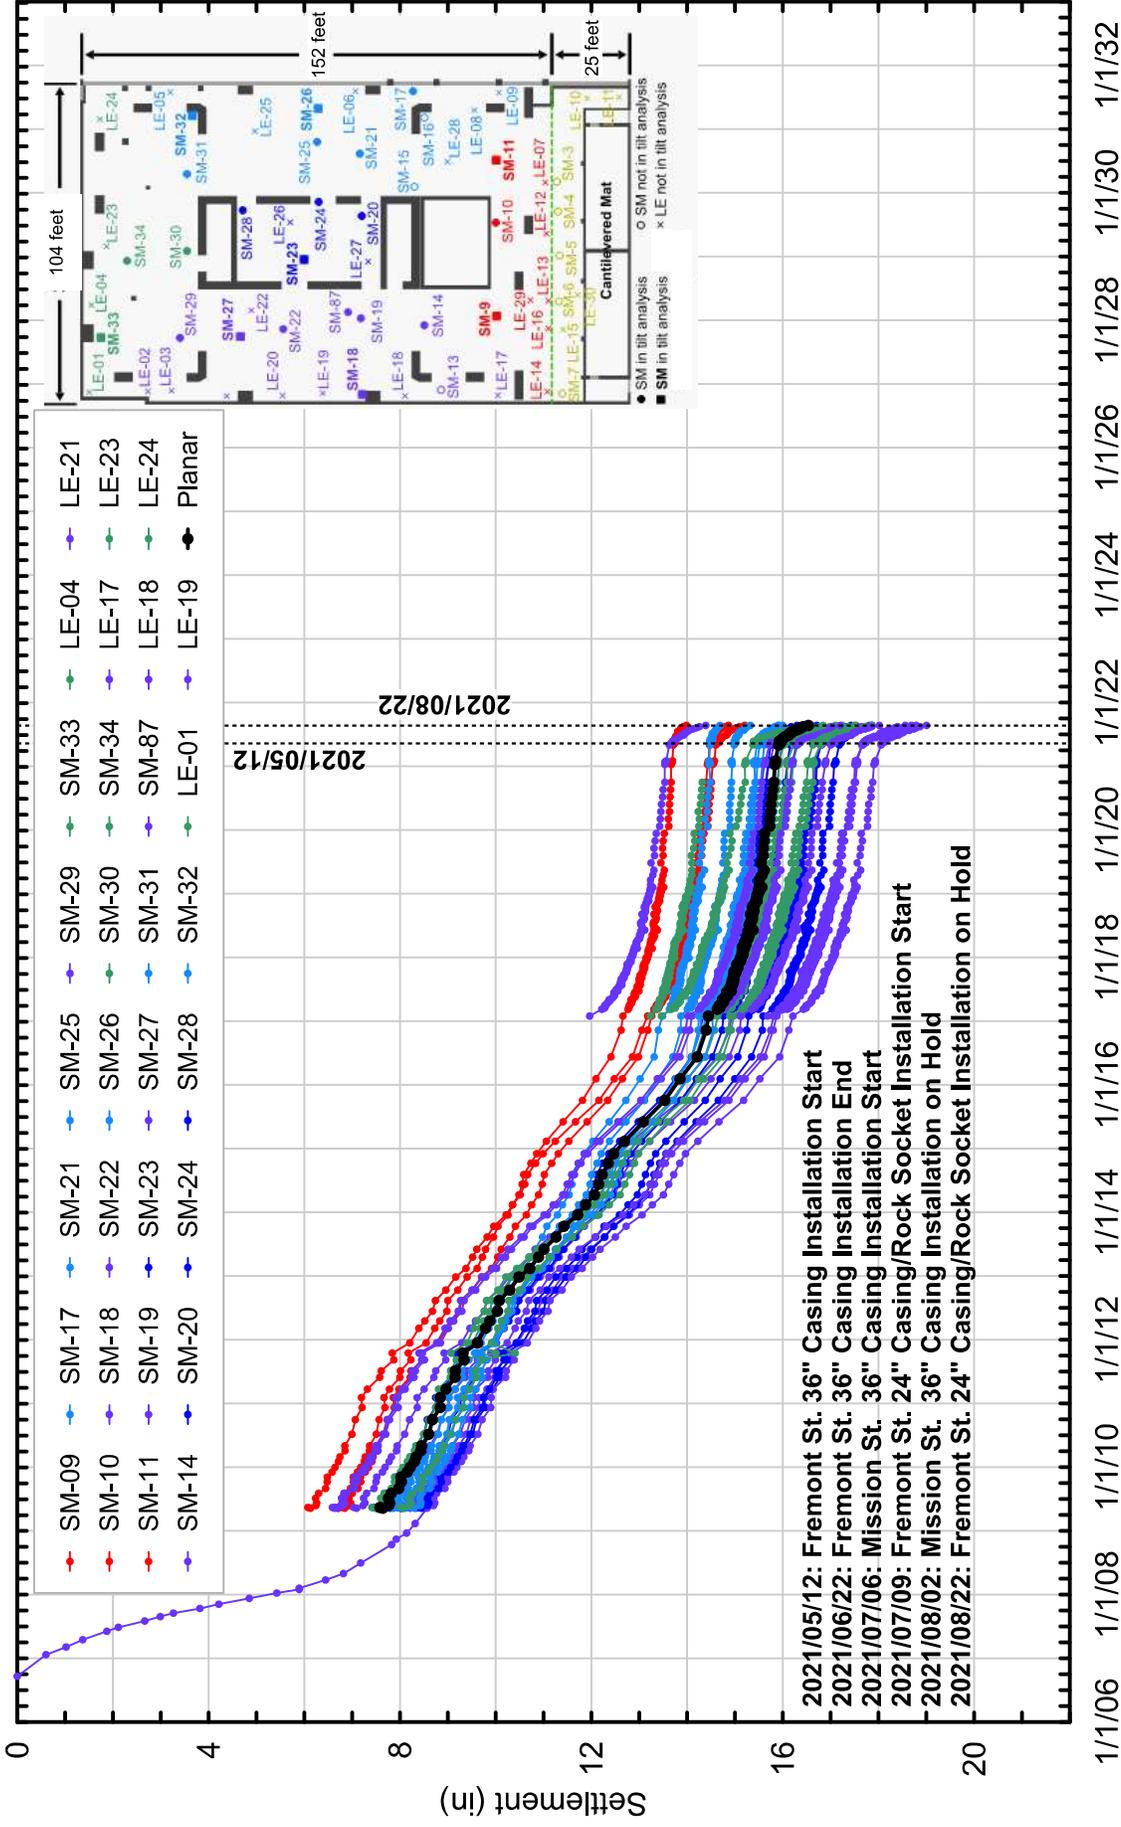


2021/05/12: Fremont St. 36" Casing Installation Start  
 2021/06/22: Fremont St. 36" Casing Installation End  
 2021/07/06: Mission St. 36" Casing Installation Start  
 2021/07/09: Fremont St. 24" Casing/Rock Socket Installation Start  
 2021/08/02: Mission St. 36" Casing Installation on Hold  
 2021/08/22: Fremont St. 24" Casing/Rock Socket Installation on Hold

Project No: 19-009.00 Date: 8/25/2021 Created By: NBW Checked By: DGM Figure No: 017-02

HISTORICAL SETTLEMENT MARKER DATA




Millennium Tower Perimeter Pile Upgrade: Instrumentation Monitoring Data  
 City and County of San Francisco, California

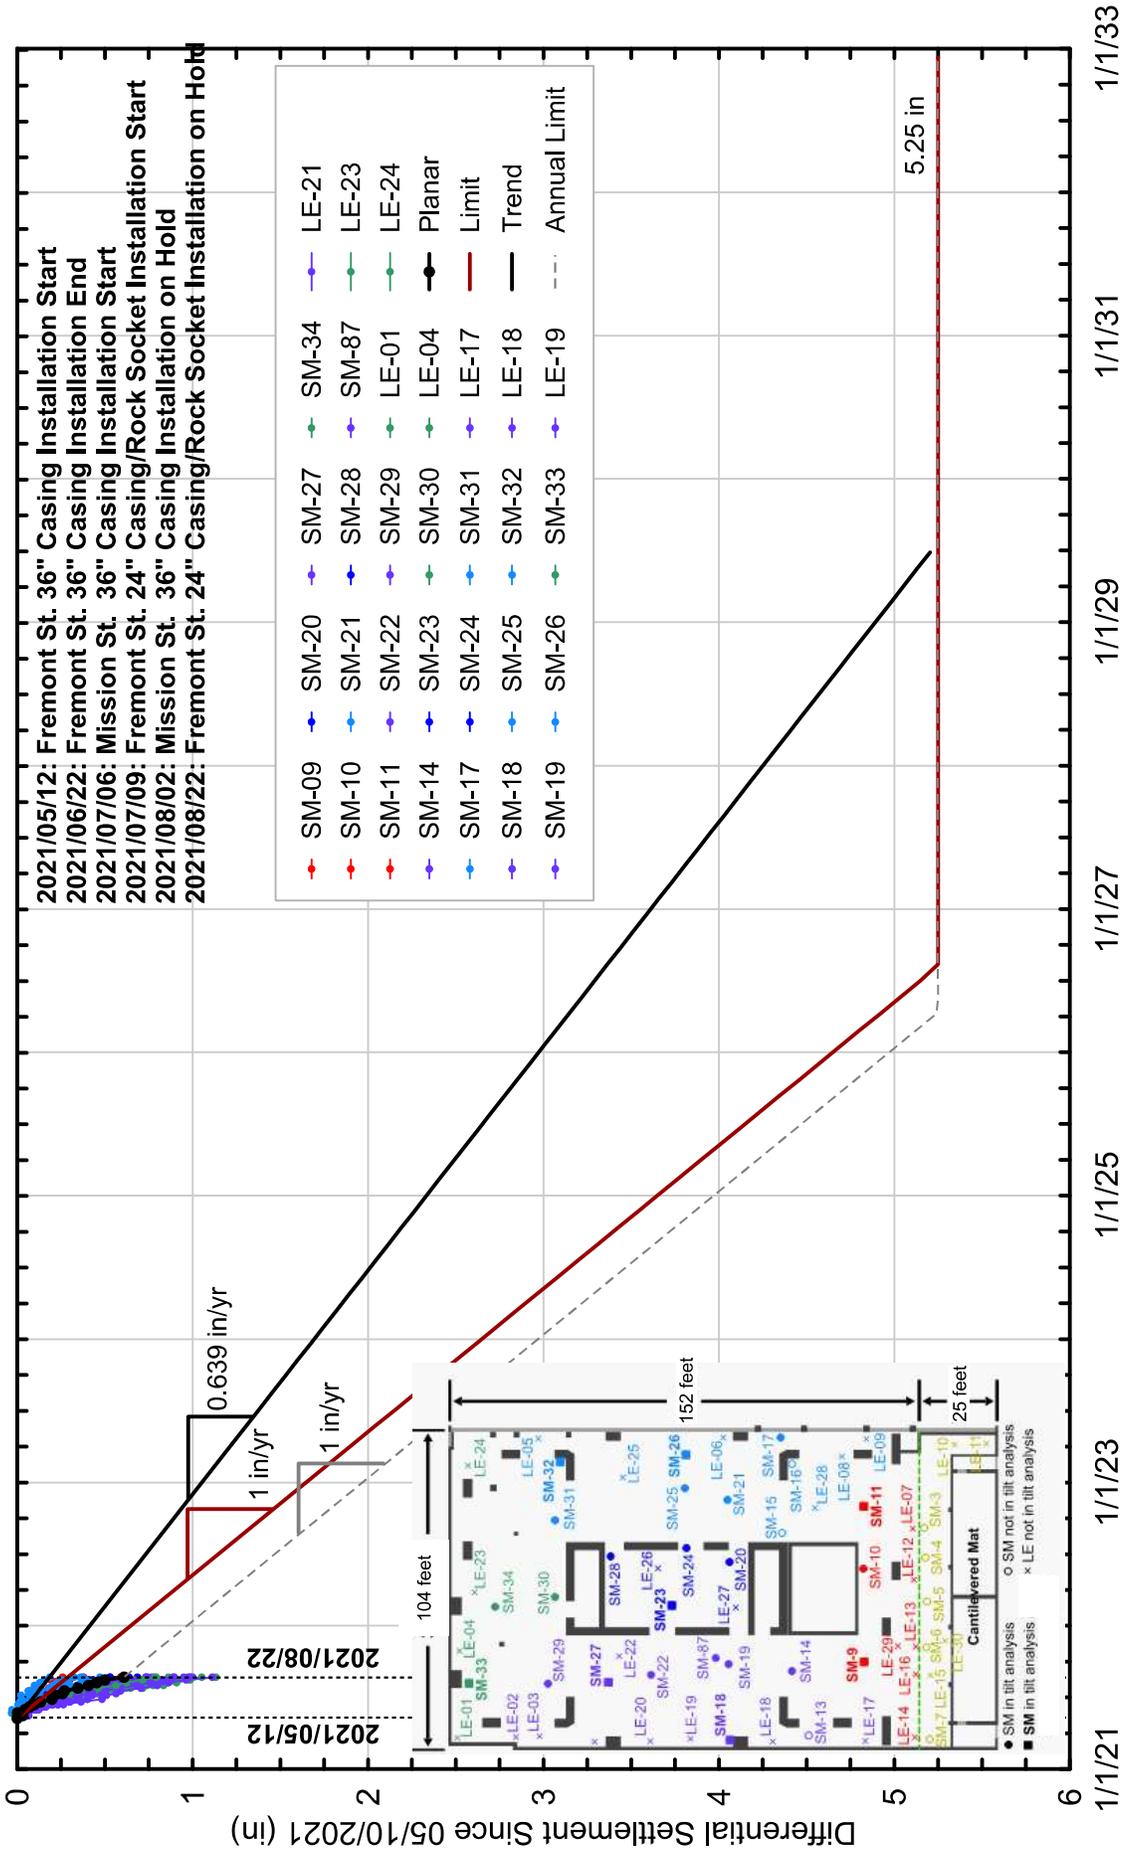

Project No: 19-009.00	Date: 8/25/2021	Created By: NBW	Checked By: DGM	Figure No: 017-03A
<b>DIFFERENTIAL SETTLEMENT MARKER DATA</b> SINCE 05/10/2021 THROUGH 08/23/2021				
Millennium Tower Perimeter Pile Upgrade: Instrumentation Monitoring Data City and County of San Francisco, California				



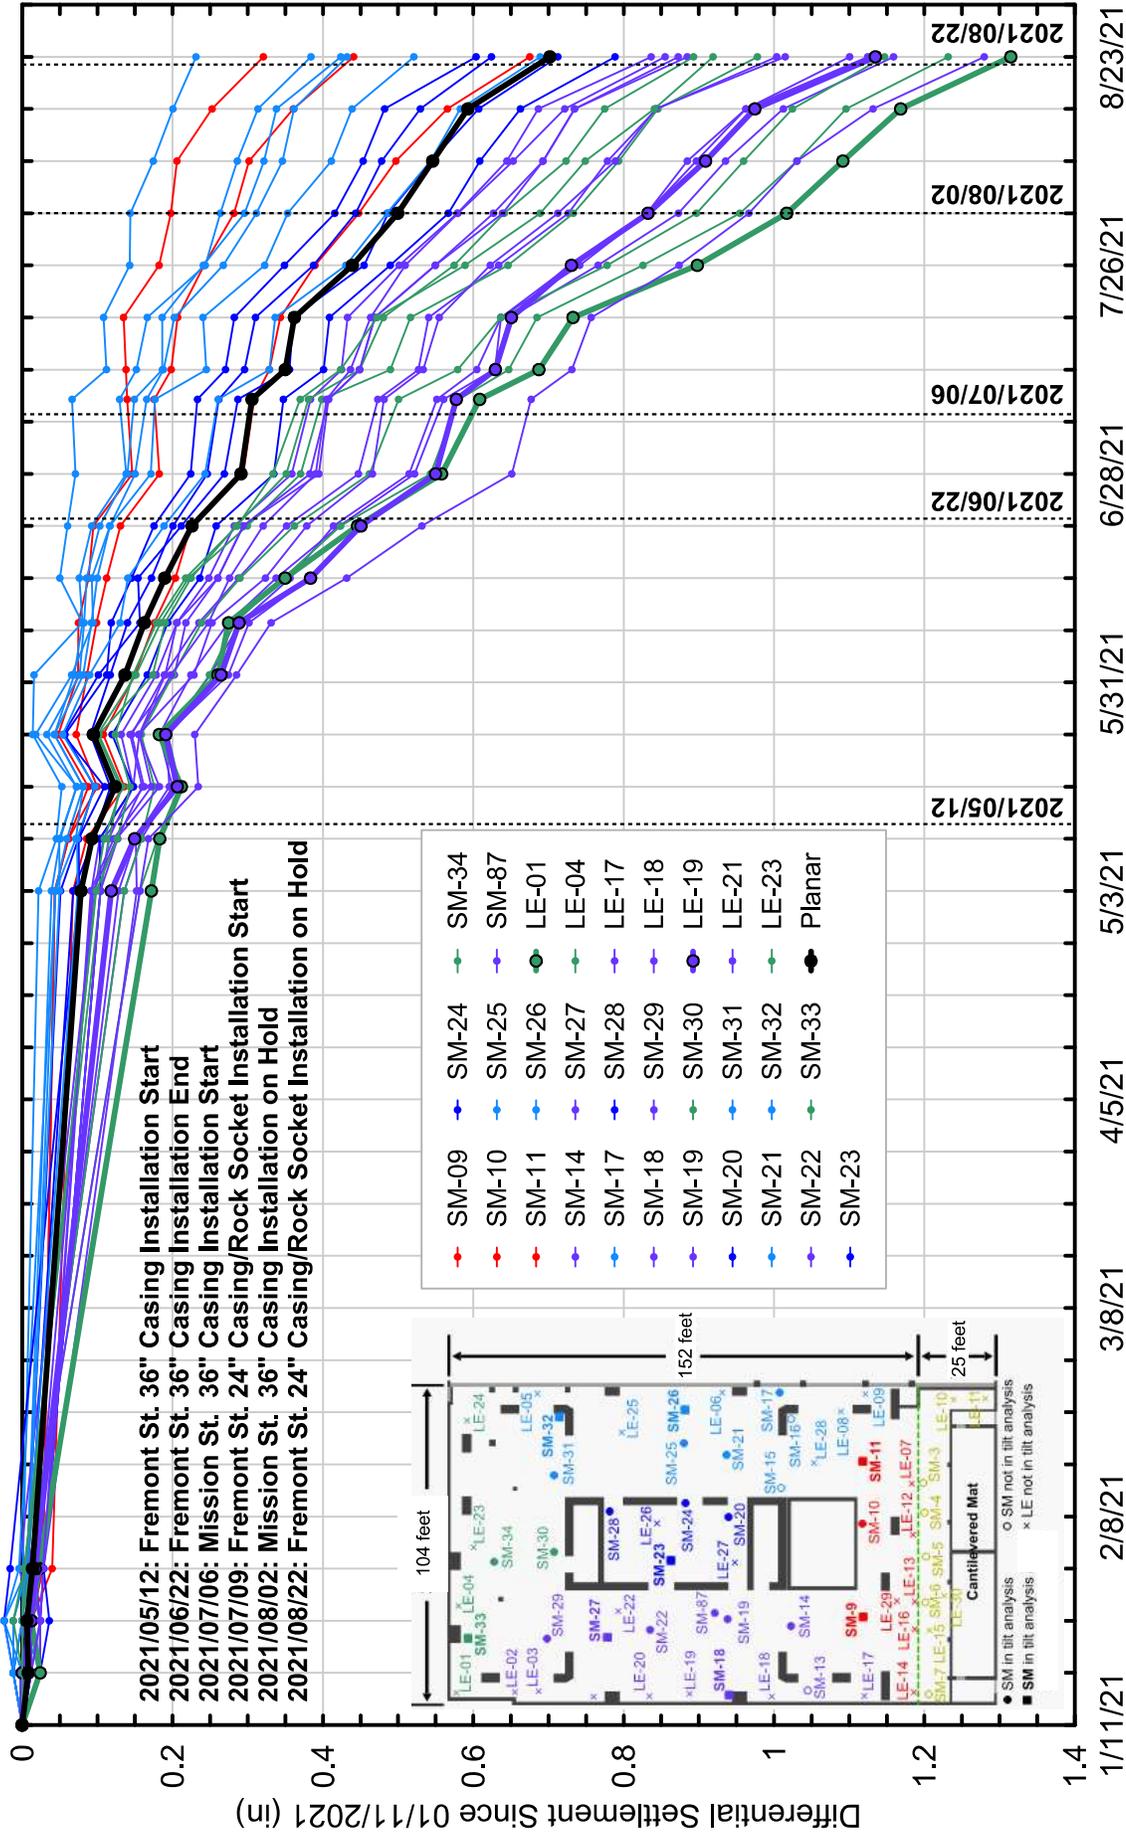


Project No: 19-009.00 Date: 8/25/2021 Created By: NBW Checked By: DGM Figure No: 017-03B

**SLATE**  
 GEOTECHNICAL CONSULTANTS

DIFFERENTIAL SETTLEMENT MARKER DATA  
 SINCE 01/11/2021 THROUGH 08/23/2021

Millennium Tower Perimeter Pile Upgrade: Instrumentation Monitoring Data  
 City and County of San Francisco, California

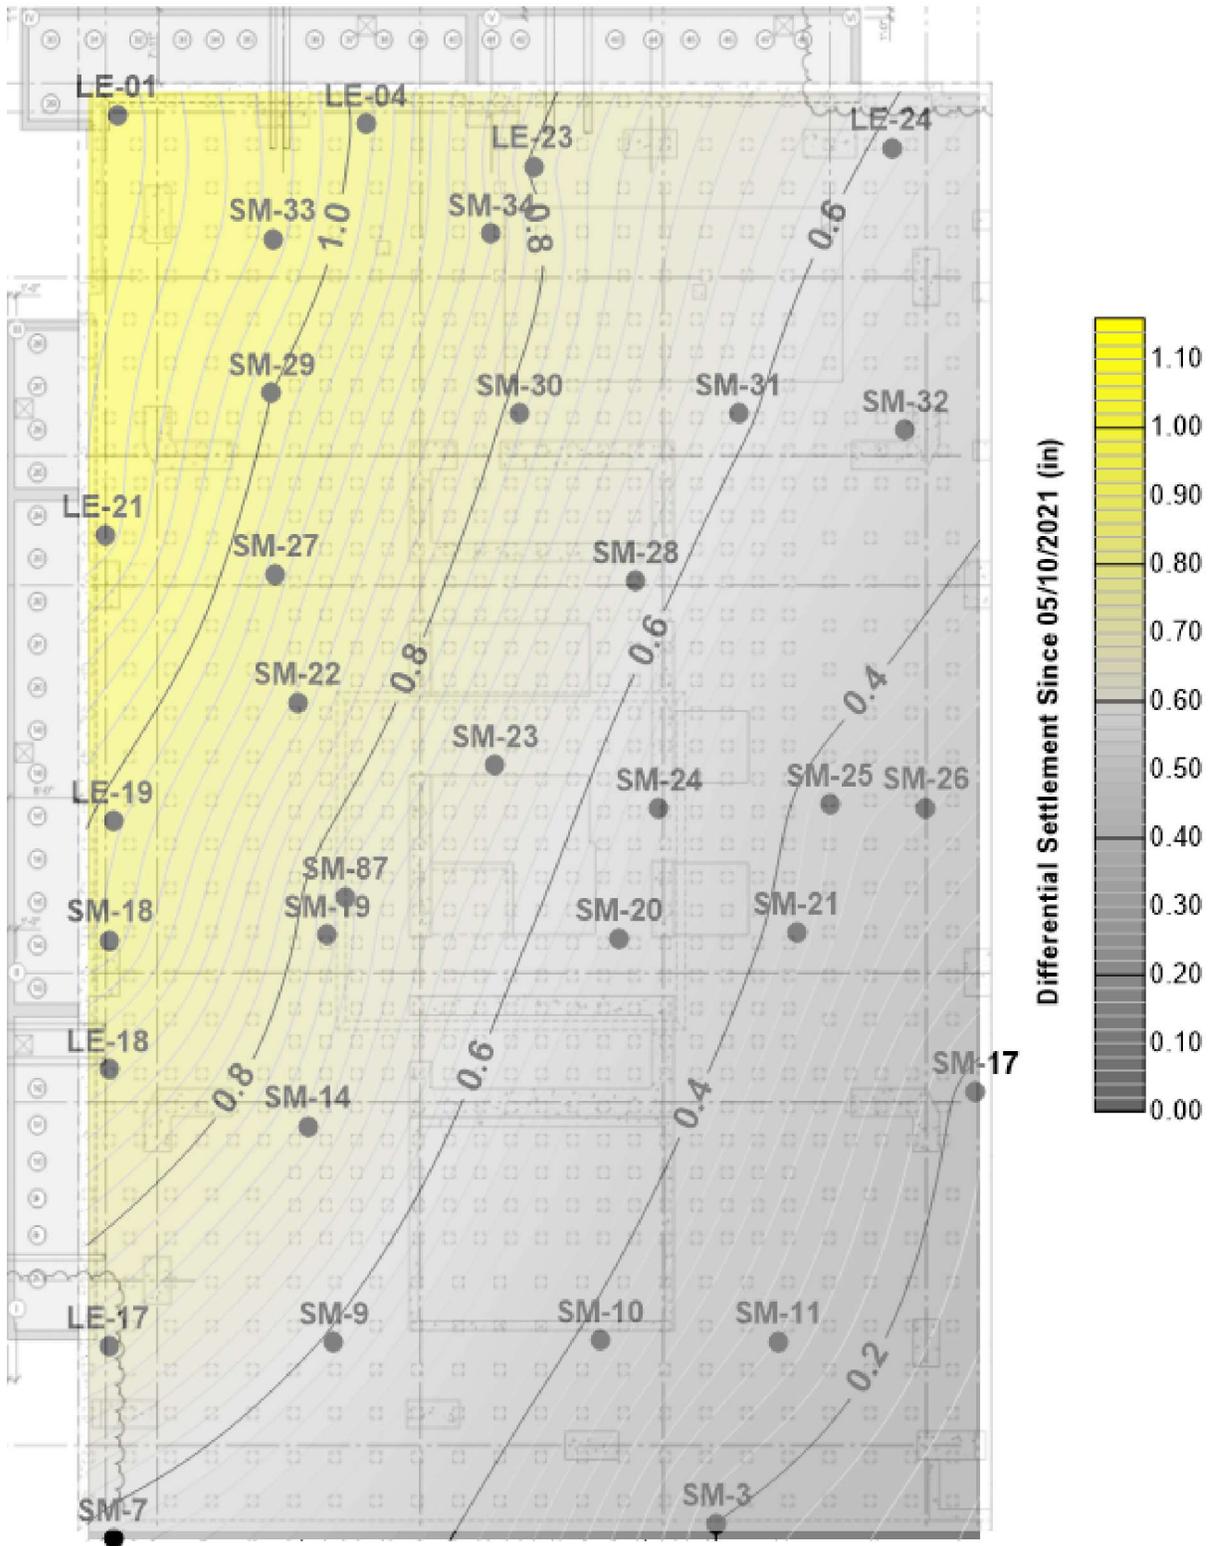

Project No: 19-009.00

Date: 8/25/2021

Created By: NBW


Checked By: DGM

Figure No: **017-04**



**DIFFERENTIAL SETTLEMENT CONTOURS  
SINCE 05/10/2021 THROUGH 08/23/2021**

Millennium Tower Perimeter Pile Upgrade: Instrumentation Monitoring Data  
City and County of San Francisco, California

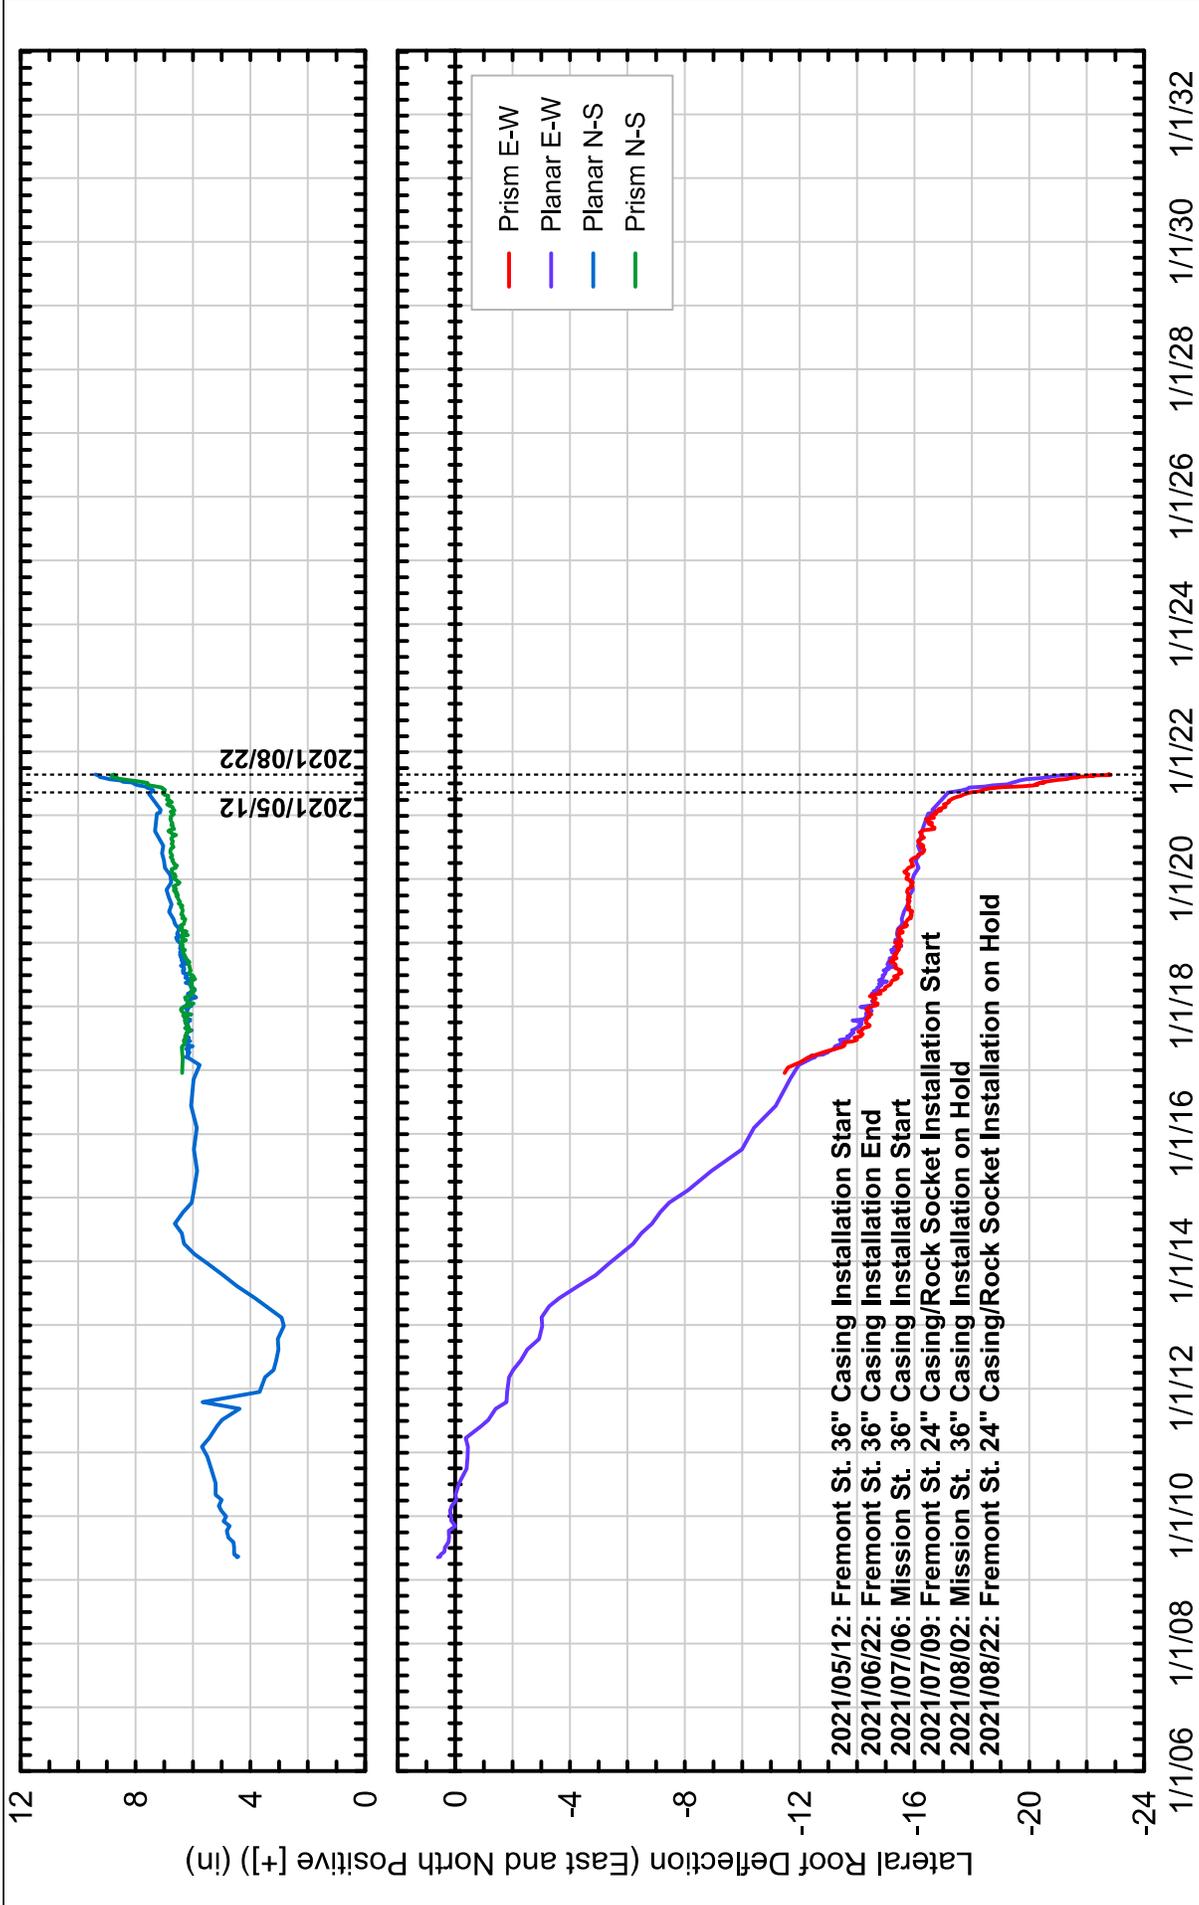


Project No: 19-009.00    Date: 8/25/2021    Created By: NBW    Checked By: DGM    Figure No: 017-05


HISTORICAL LATERAL ROOF DEFLECTION DATA



Millennium Tower Perimeter Pile Upgrade: Instrumentation Monitoring Data  
City and County of San Francisco, California

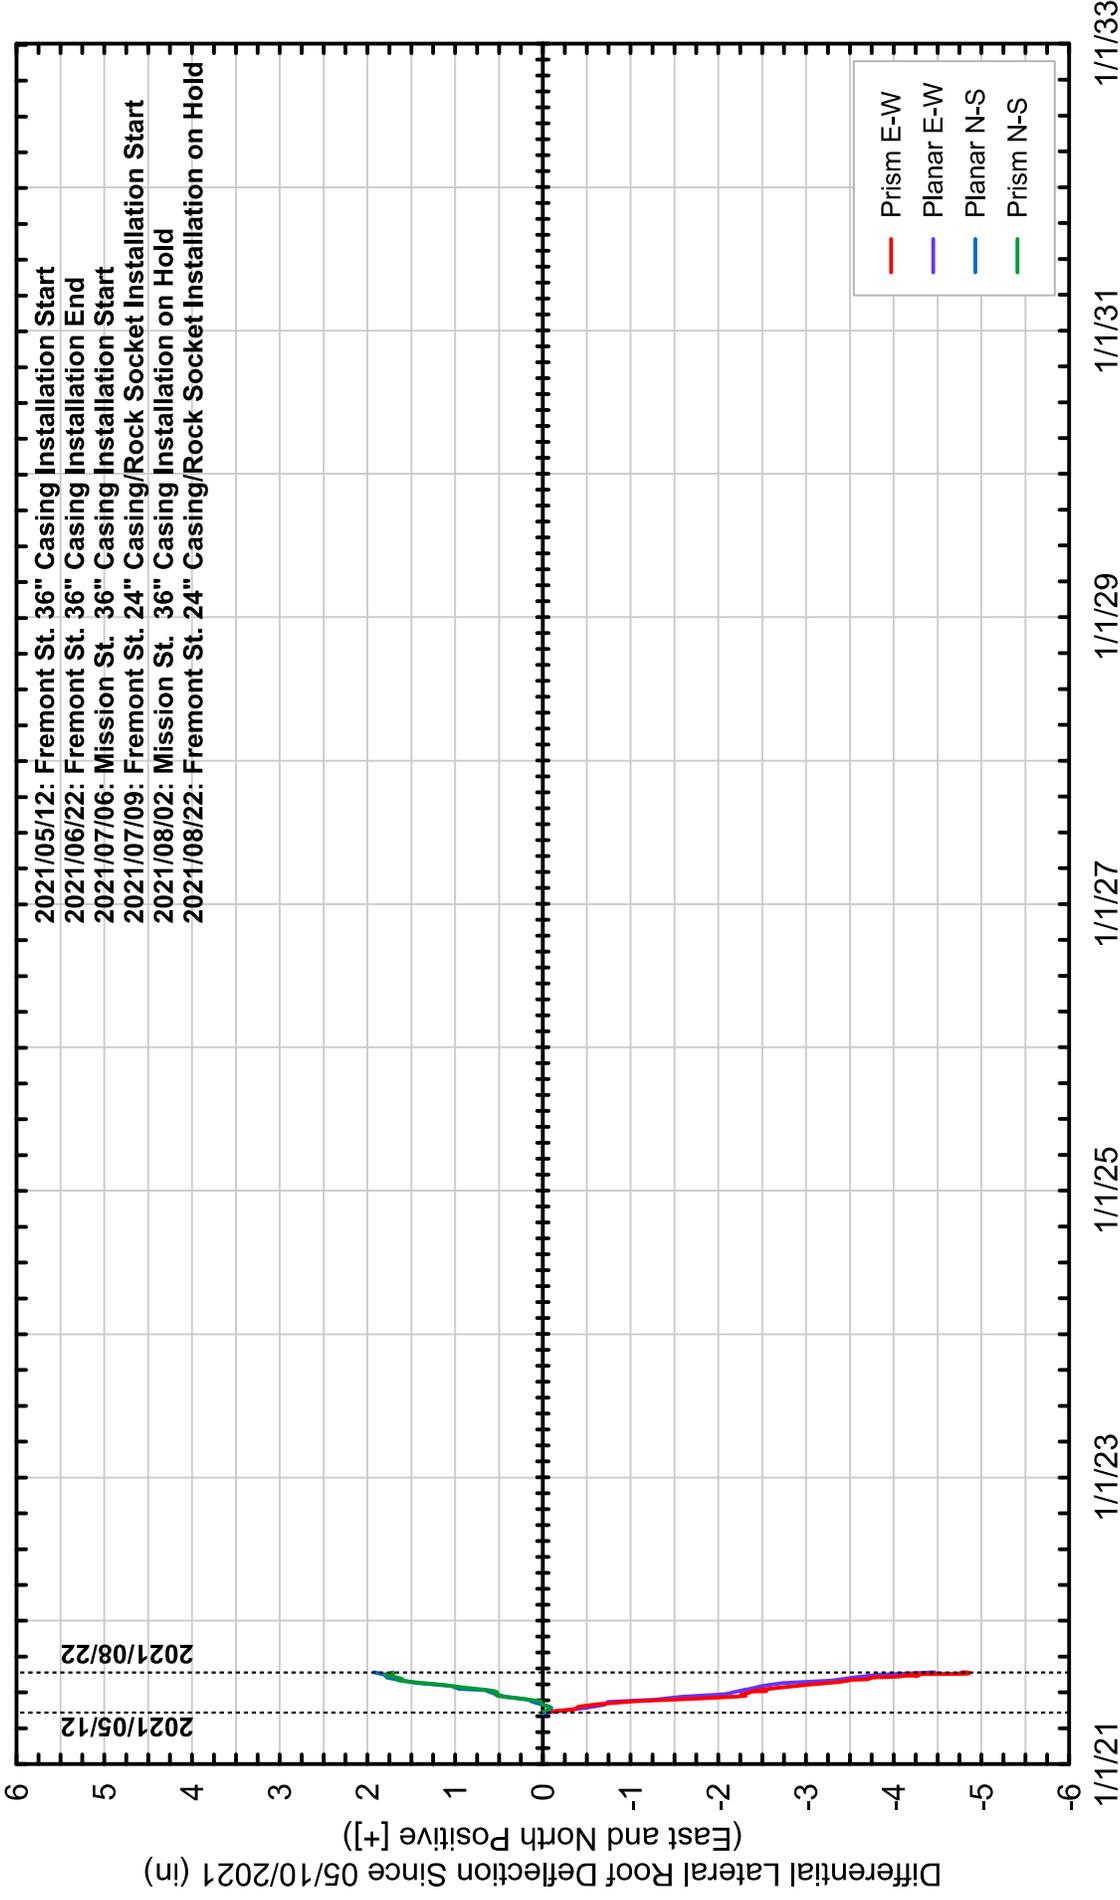

Project No: 19-009.00	Date: 8/25/2021	Created By: NBW	Checked By: DGM	Figure No: 017-06A
				
DIFFERENTIAL LATERAL ROOF DEFLECTION DATA SINCE 05/10/2021 THROUGH 08/23/2021  Millennium Tower Perimeter Pile Upgrade: Instrumentation Monitoring Data City and County of San Francisco, California				

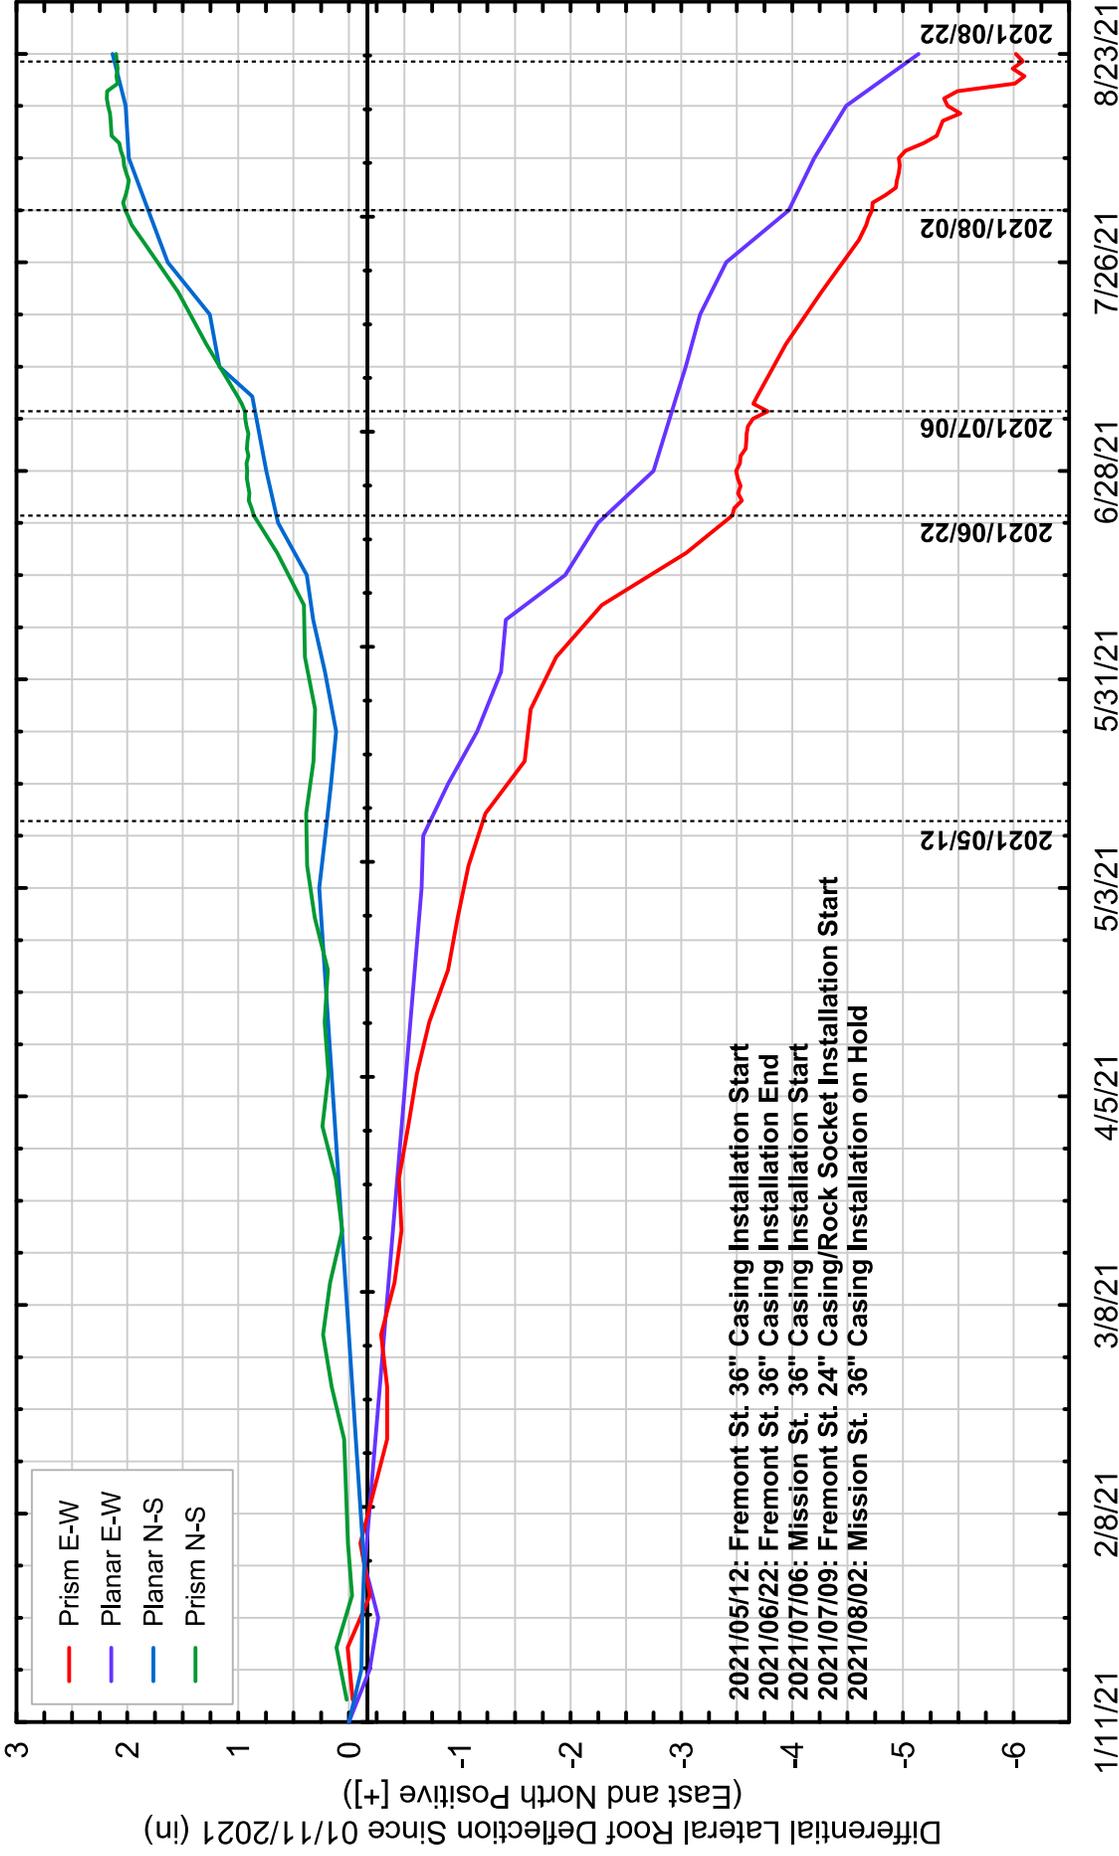


Project No: 19-009.00	Date: 8/25/2021	Created By: NBW	Checked By: DGM	Figure No: 017-06B
-----------------------	-----------------	-----------------	-----------------	--------------------

**SLATE**  
GEOTECHNICAL CONSULTANTS

DIFFERENTIAL LATERAL ROOF DEFLECTION DATA  
SINCE 01/11/2021 THROUGH 08/23/2021

Millennium Tower Perimeter Pile Upgrade: Instrumentation Monitoring Data  
City and County of San Francisco, California

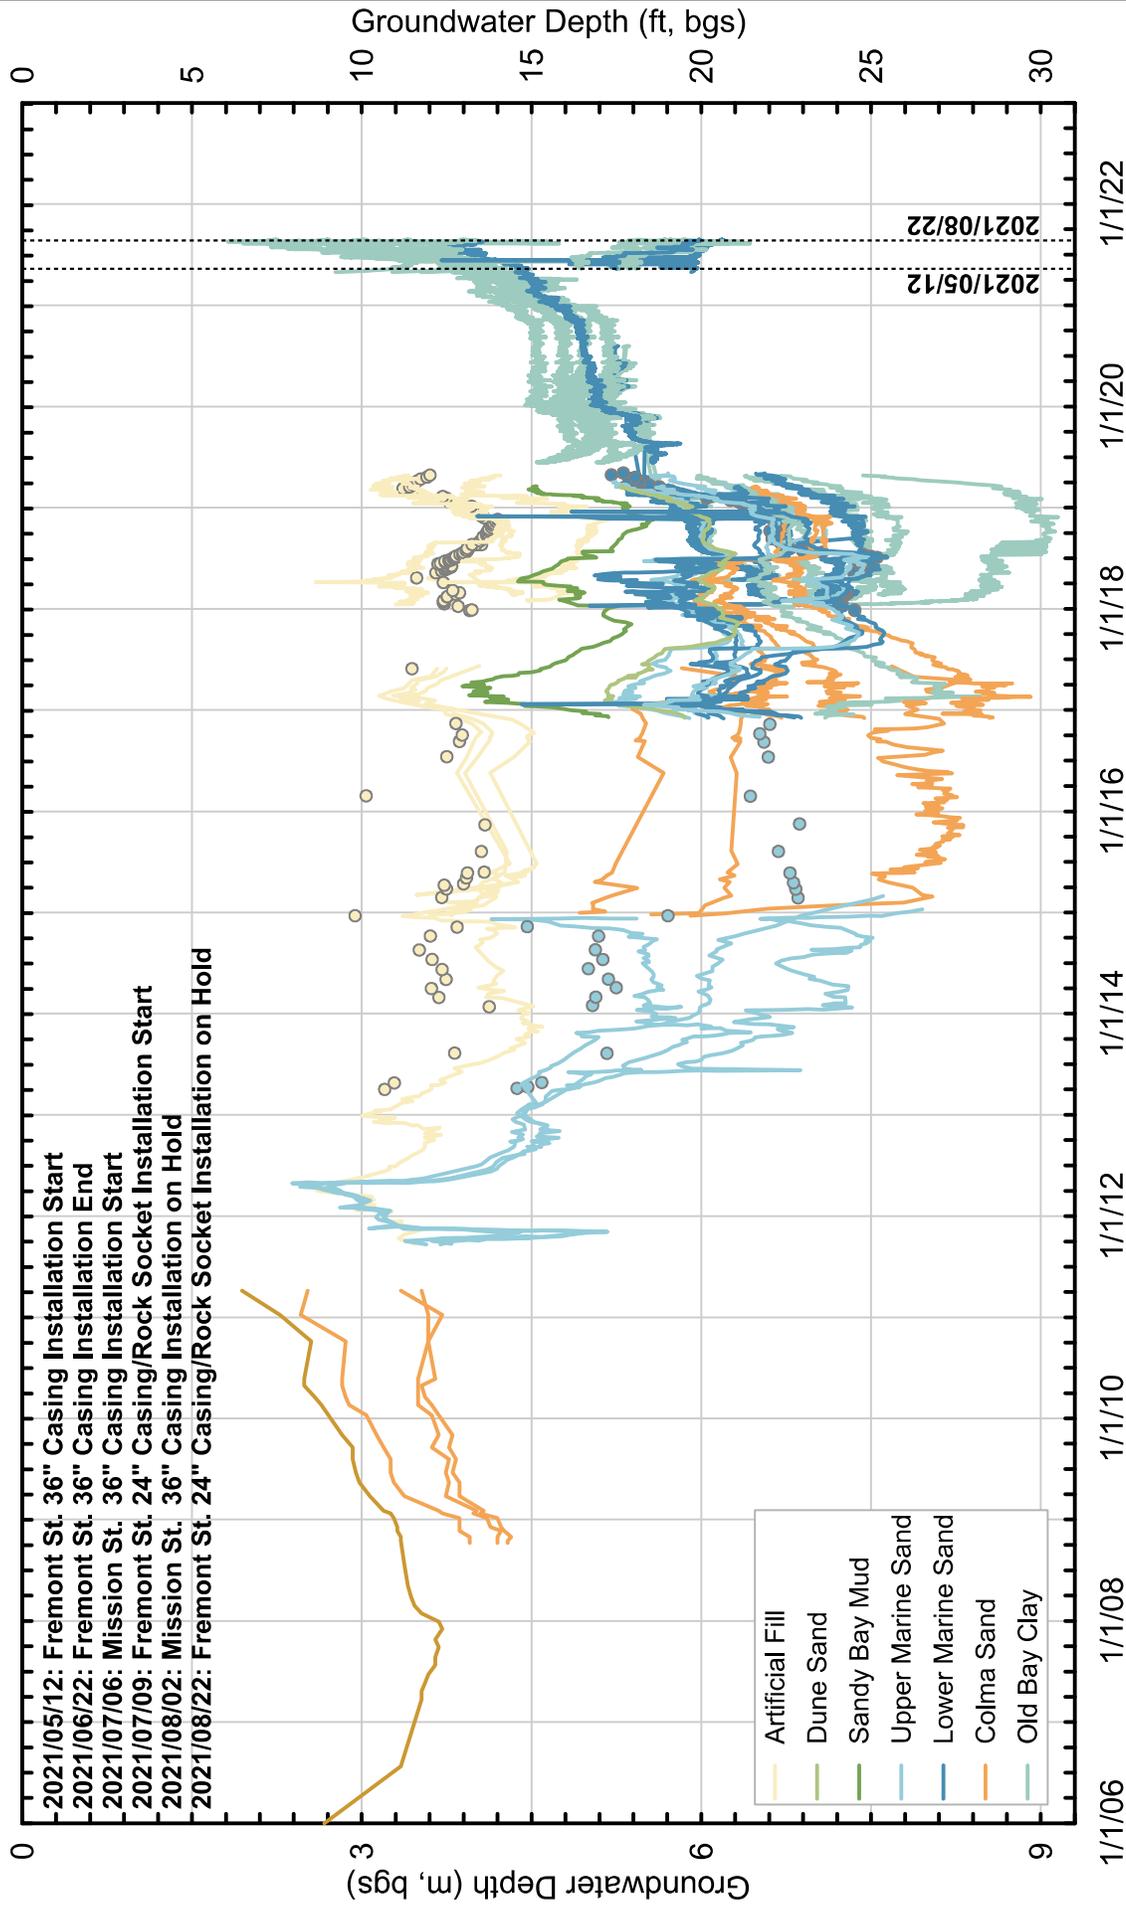

Project No: 19-009.00

Date: 8/25/2021

Created By: NBW


Checked By: DGM

Figure No: 017-07



HISTORICAL GROUNDWATER ELEVATION MEASUREMENTS  
AT LOCATIONS NEAR 301 MISSION

Millennium Tower Perimeter Pile Upgrade: Instrumentation Monitoring Data  
City and County of San Francisco, California

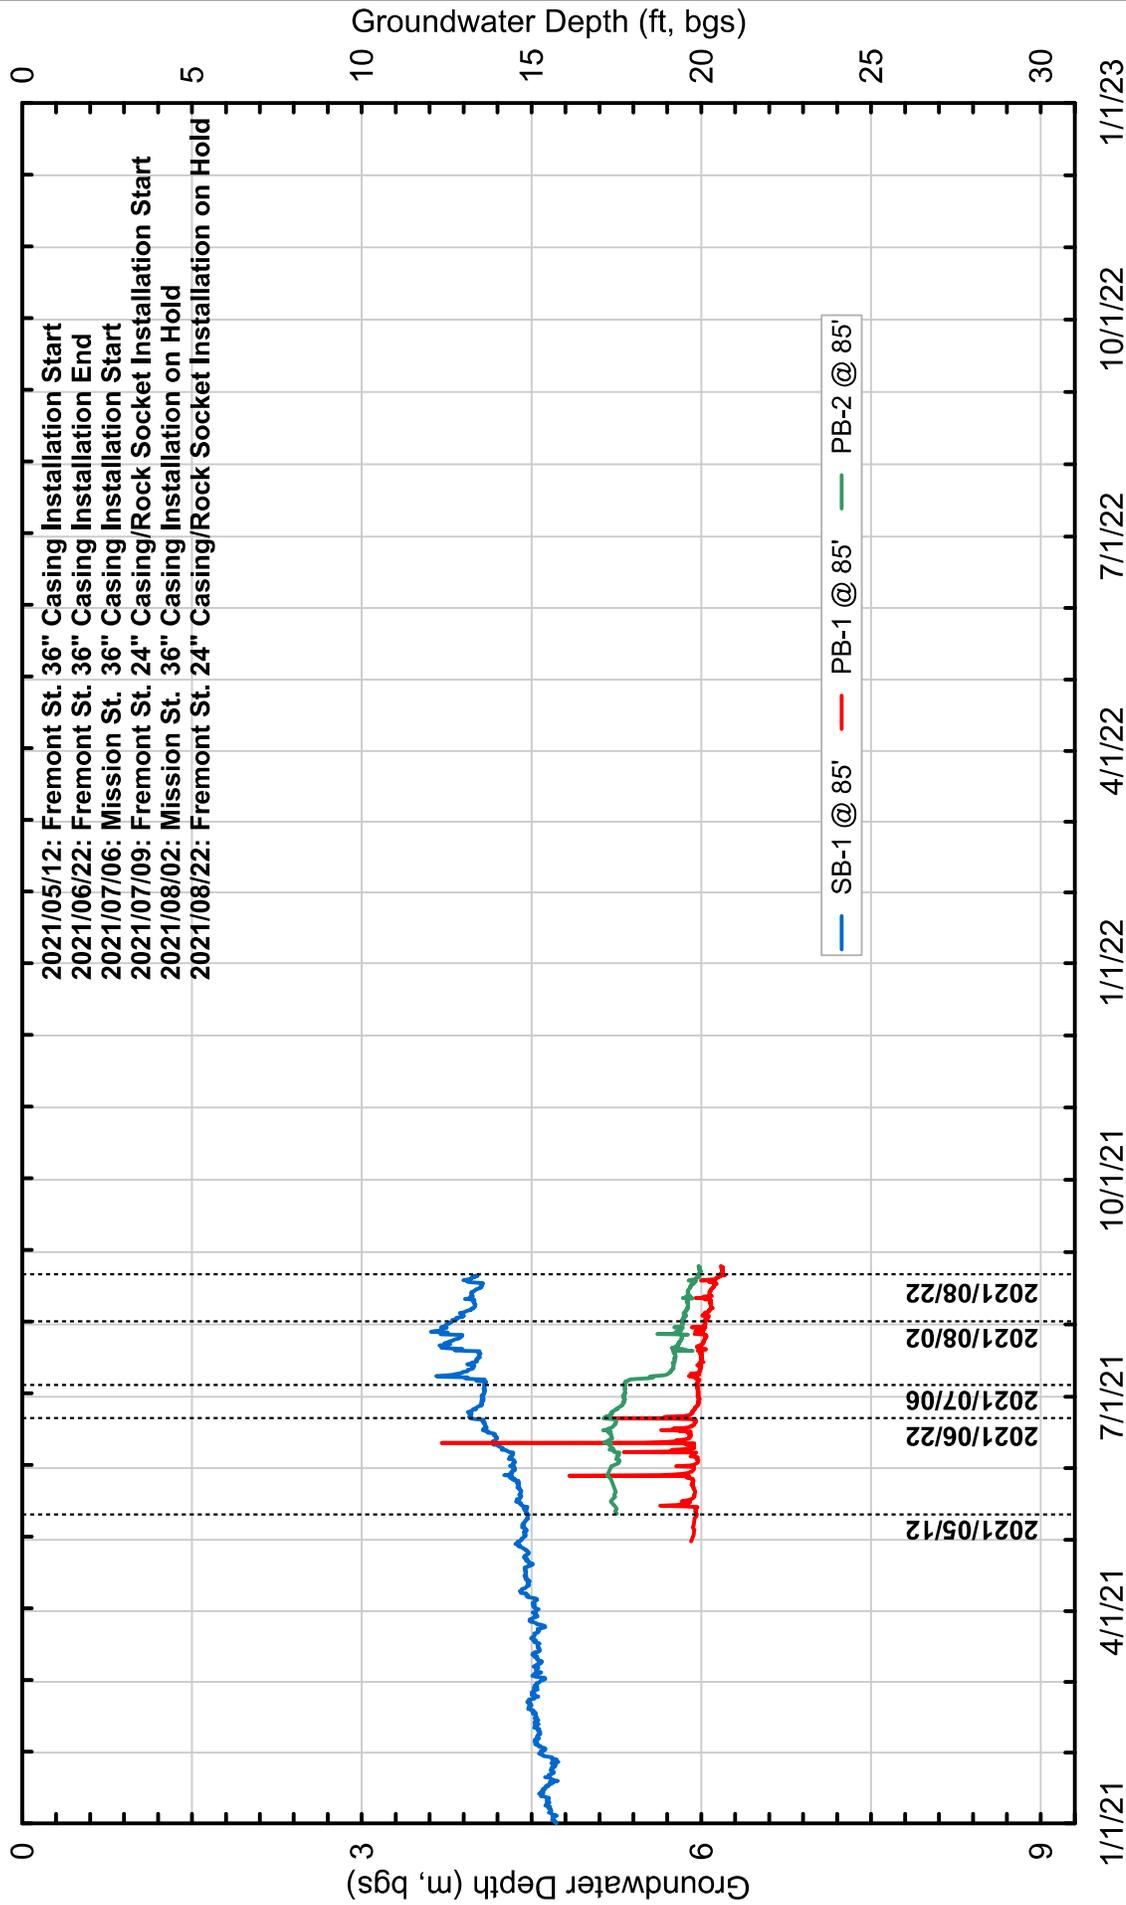


Project No: 19-009.00	Date: 8/25/2021	Created By: NBW	Checked By: DGM	Figure No: 017-08
-----------------------	-----------------	-----------------	-----------------	-------------------

**SLATE**  
 GEOTECHNICAL CONSULTANTS

GROUNDWATER ELEVATION MEASUREMENTS IN MARINE AND COLMA SAND  
 SINCE 01/01/2021 THROUGH 08/25/2021

Millennium Tower Perimeter Pile Upgrade: Instrumentation Monitoring Data  
 City and County of San Francisco, California

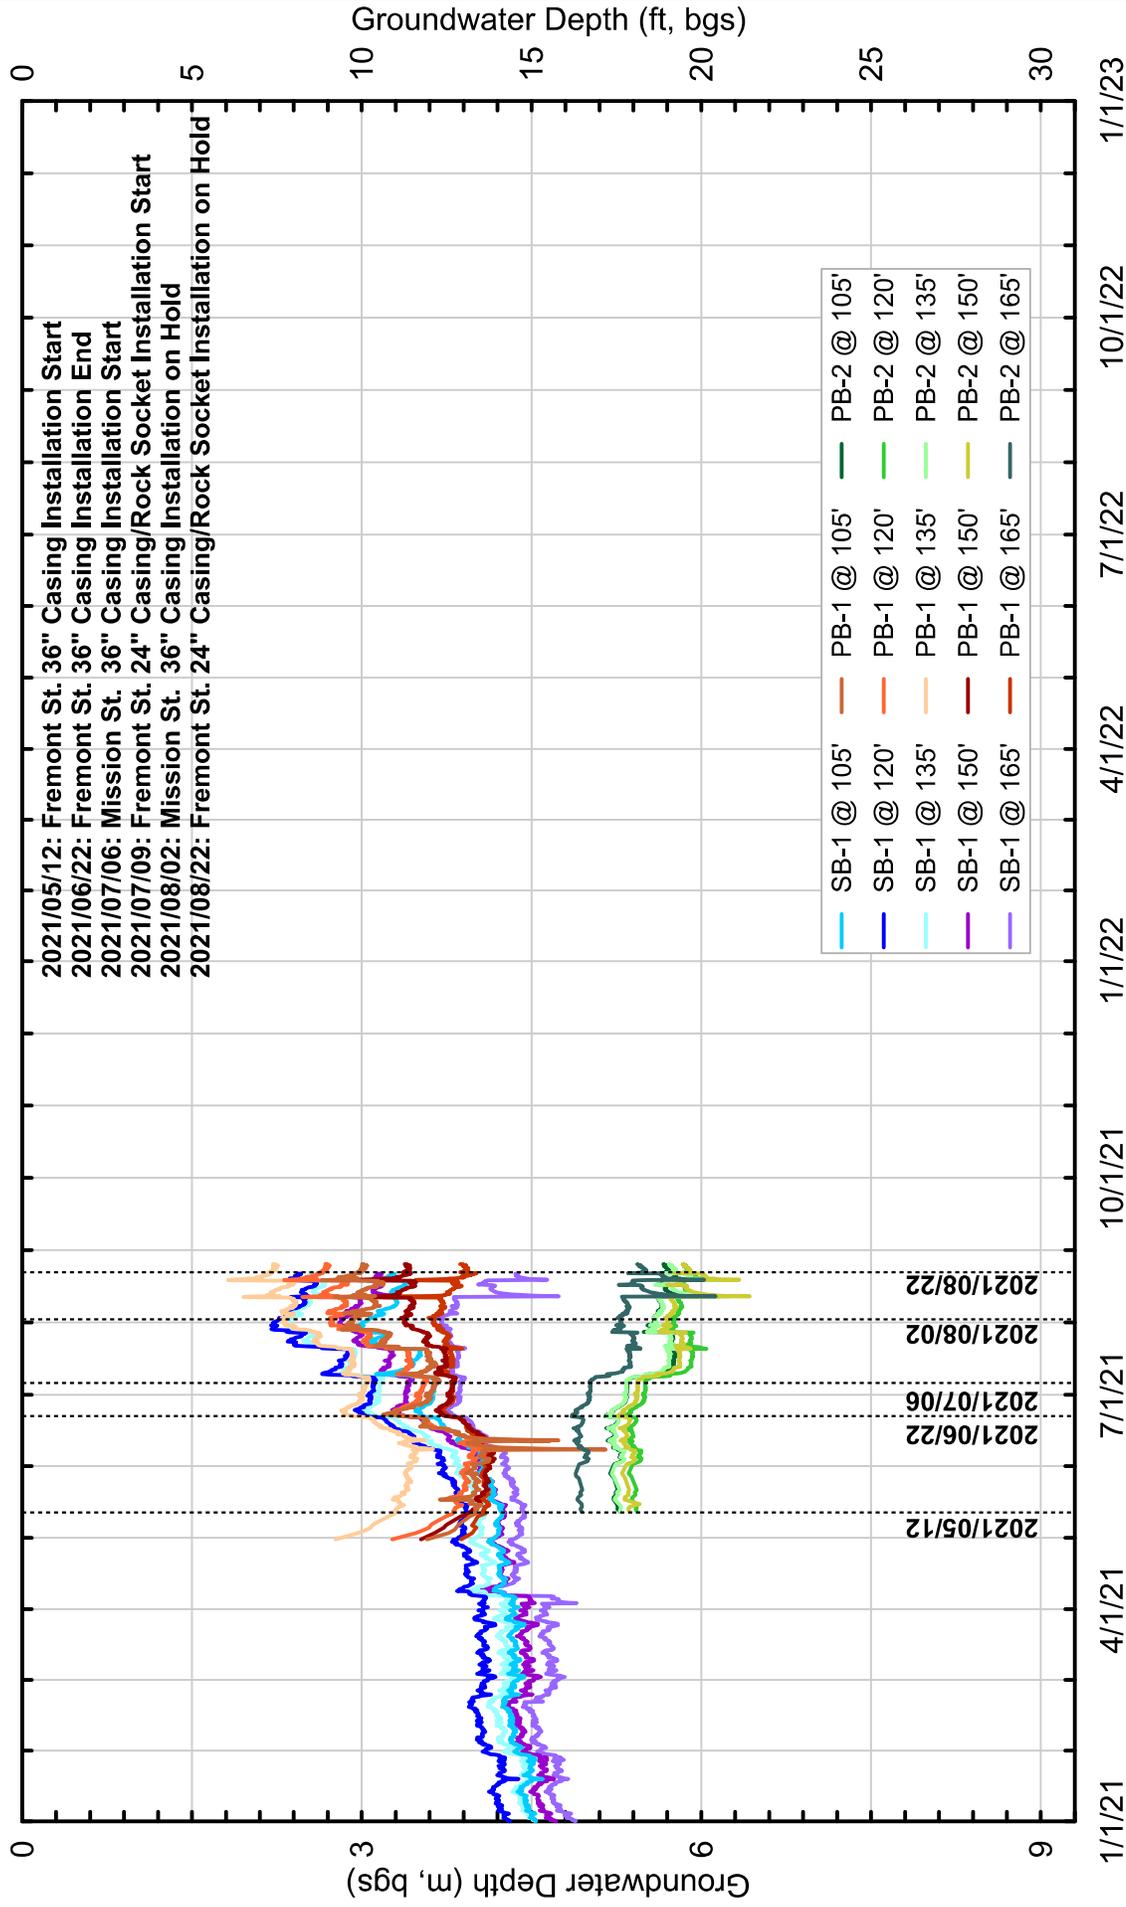


Project No: 19-009.00	Date: 8/25/2021	Created By: NBW	Checked By: DGM	Figure No: 017-09
-----------------------	-----------------	-----------------	-----------------	-------------------


**SLATE**  
GEOTECHNICAL CONSULTANTS

GROUNDWATER ELEVATION MEASUREMENTS IN OLD BAY CLAY  
SINCE 01/01/2021 THROUGH 08/25/2021

Millennium Tower Perimeter Pile Upgrade: Instrumentation Monitoring Data  
City and County of San Francisco, California

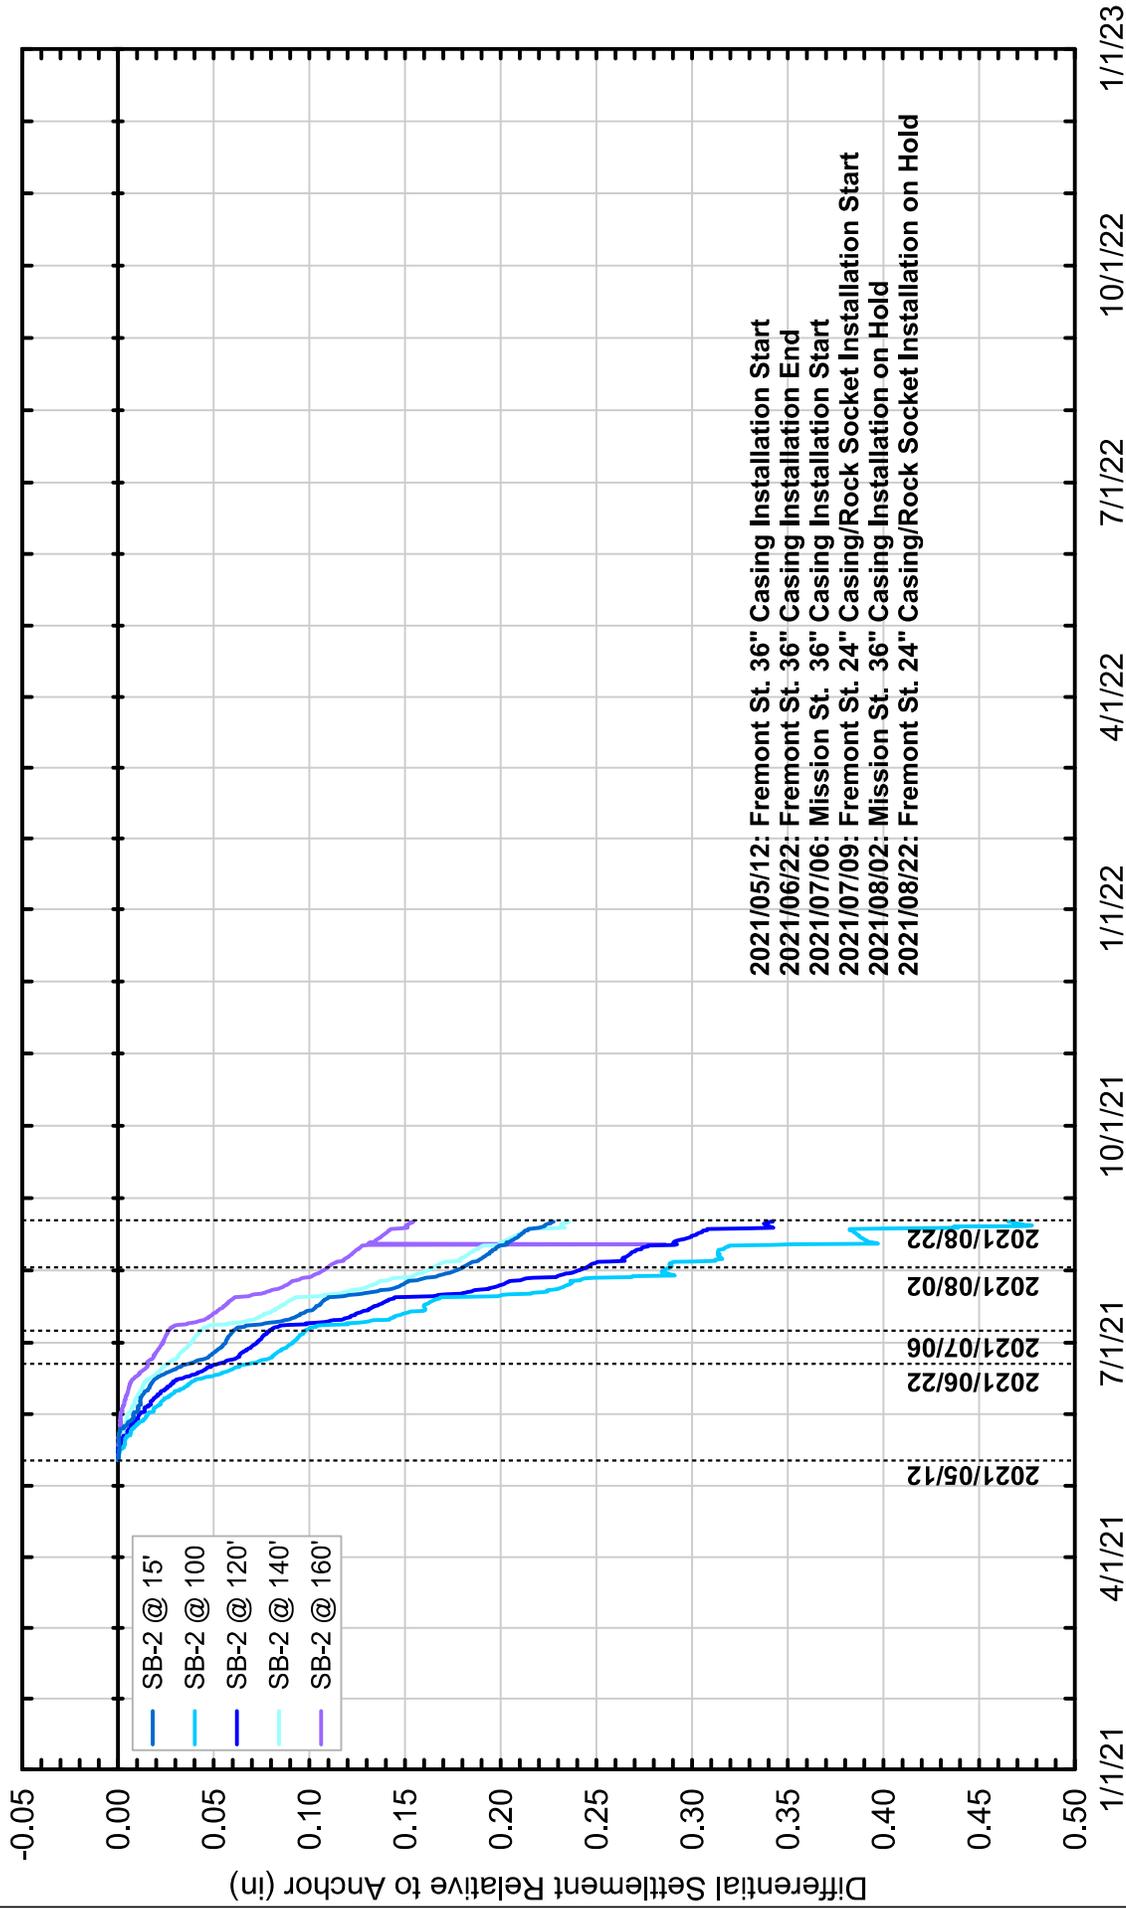

Project No: 19-009.00	Date: 8/25/2021	Created By: NBW	Checked By: DGM	Figure No: 017-10
				
DIFFERENTIAL EXTENSOMETER DATA FROM WITHIN TOWER BASEMENT SINCE 01/01/2021 THROUGH 08/25/2021				
Millennium Tower Perimeter Pile Upgrade: Instrumentation Monitoring Data City and County of San Francisco, California				

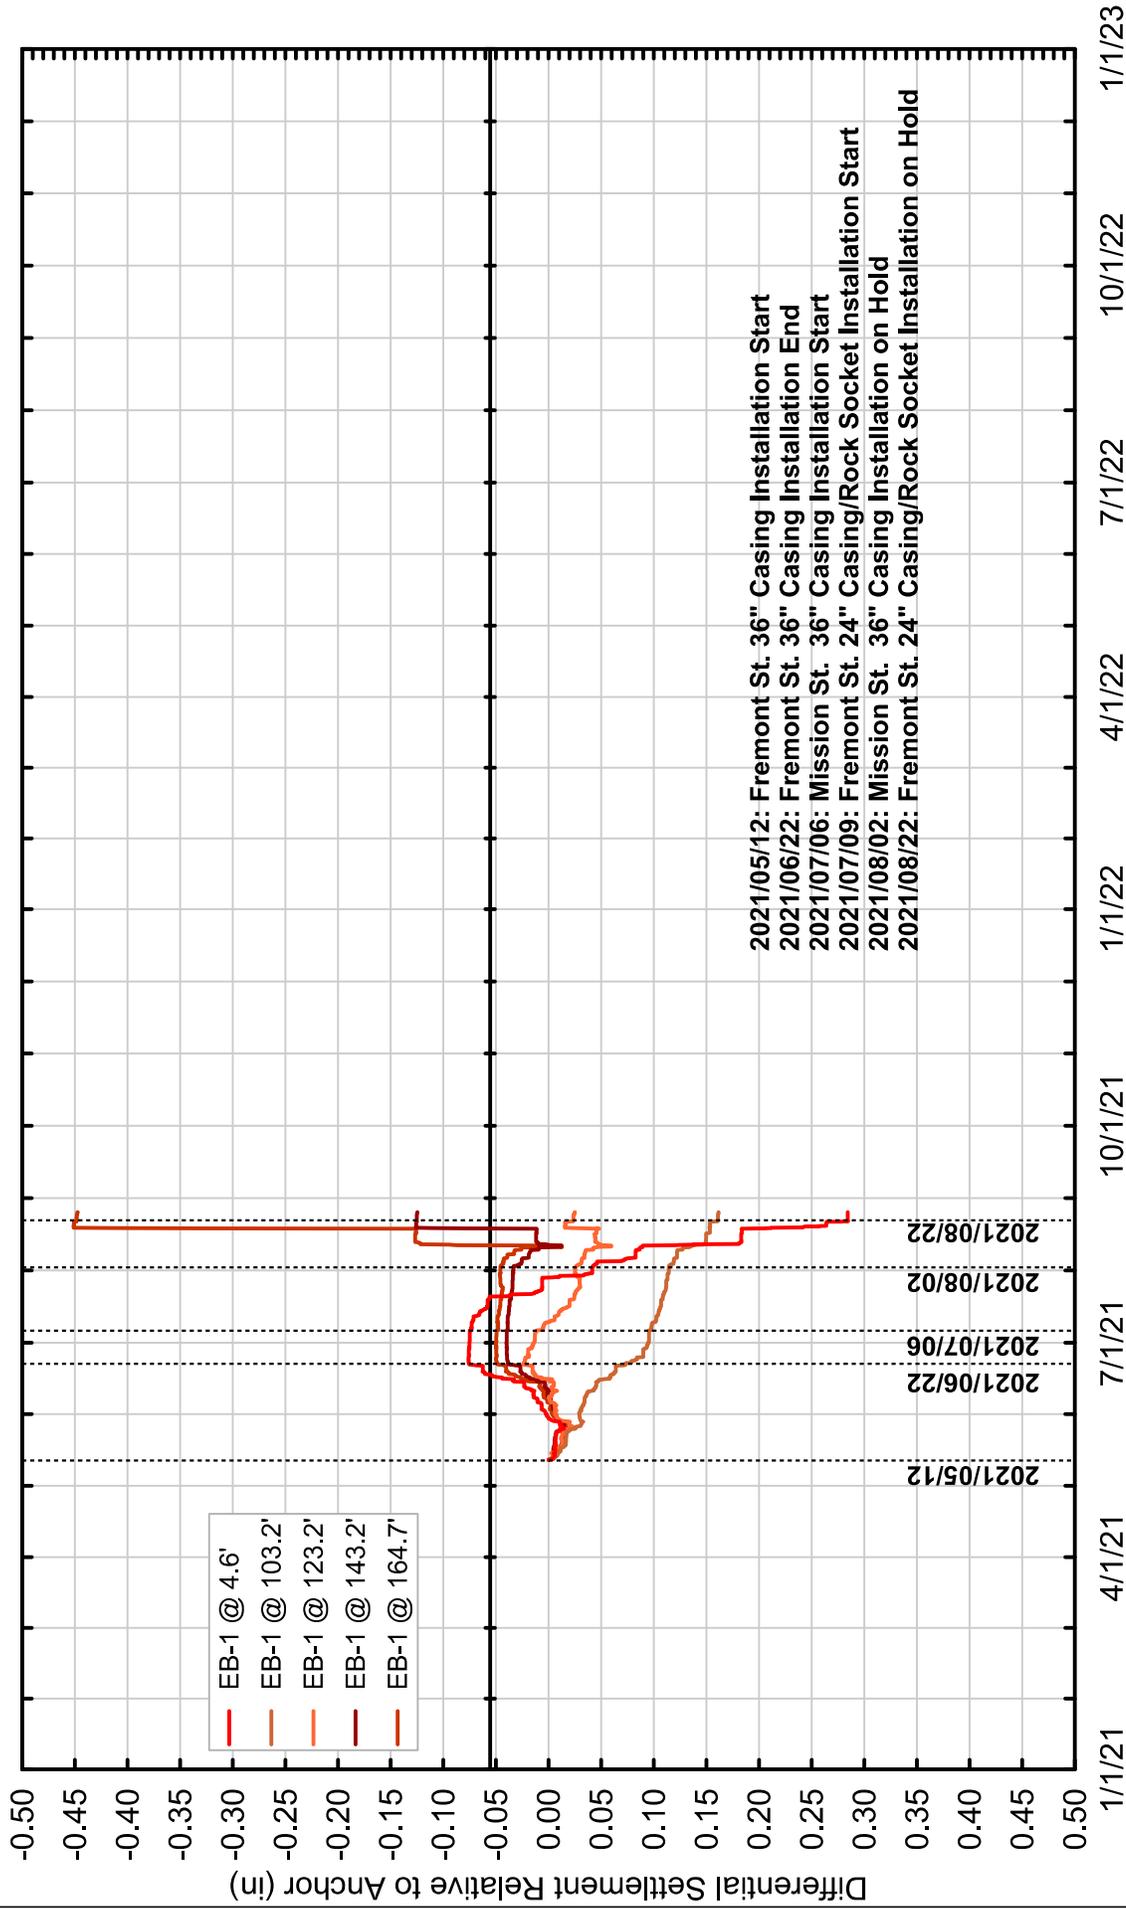


Project No: 19-009.00	Date: 8/25/2021	Created By: NBW	Checked By: DGM	Figure No: 017-11
-----------------------	-----------------	-----------------	-----------------	-------------------

**SLATE**  
GEOTECHNICAL CONSULTANTS

DIFFERENTIAL EXTENSOMETER DATA FROM FREMONT STREET  
SINCE 01/01/2021 THROUGH 08/25/2021

Millennium Tower Perimeter Pile Upgrade: Instrumentation Monitoring Data  
City and County of San Francisco, California

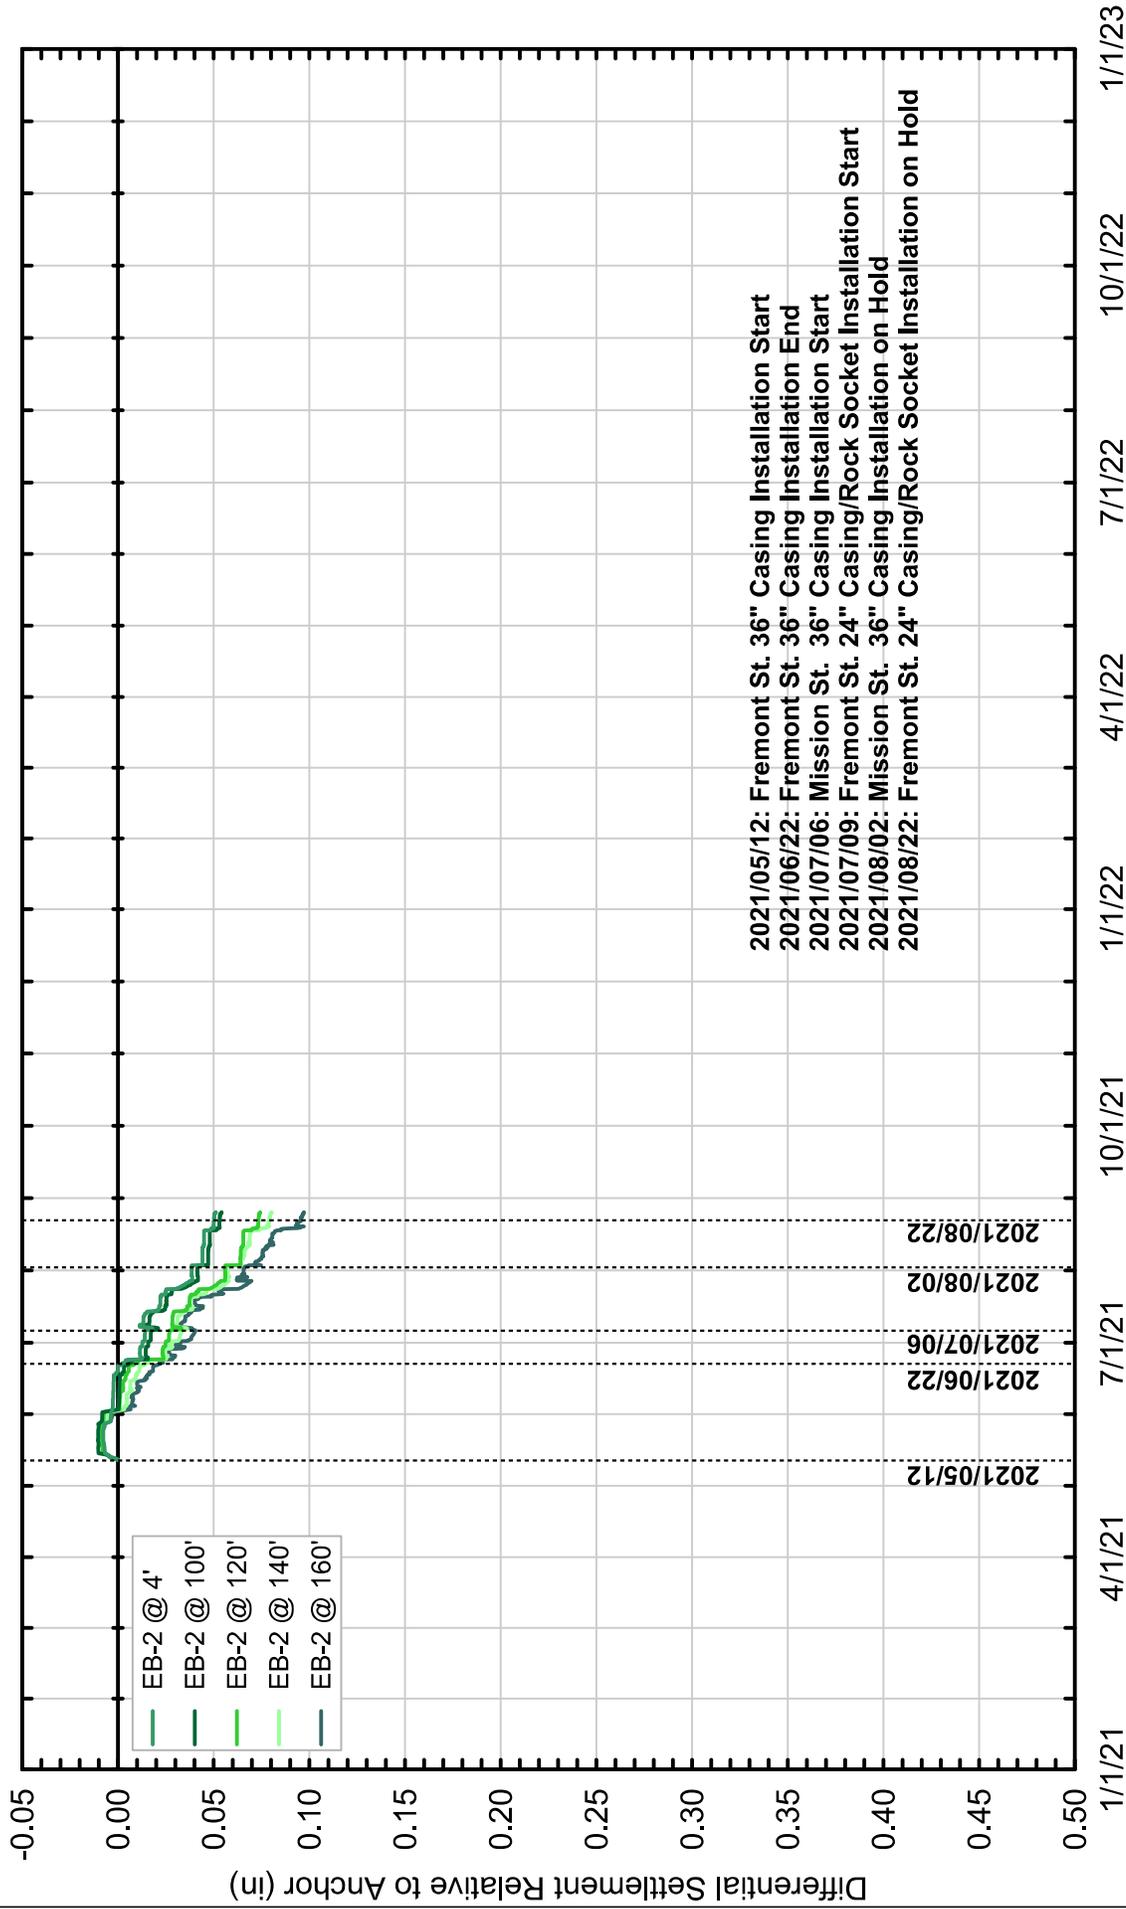

Project No: 19-009.00	Date: 8/25/2021	Created By: NBW	Checked By: DGM	Figure No: 017-12
				
DIFFERENTIAL EXTENSOMETER DATA FROM MISSION STREET SINCE 01/01/2021 THROUGH 08/25/2021  Millennium Tower Perimeter Pile Upgrade: Instrumentation Monitoring Data City and County of San Francisco, California				